



Section : Engine  
 Ref. No. : EG-4021  
 Date : Nov., 2004  
 Page : 1 of 1

Area Application : Europe

Model Name : TOYOTA RAV4

Model Code : CLA2#

**Subject : 1CD-FTV V-ribbed Belt Squeal Noise**

This TSB is to inform you of Field/Fix method and countermeasure of titled phenomenon.

Description of Phenomenon :

"Squeal Noise" can be heard from the engine compartment when the engine is cold and during warm-up.

The noise is most audible in idle condition and be reproduced if the vehicle is washed or when there is rain.

Production Improvement :

Change the material of the "V-ribbed Belt".

Production Effective :

Model	Effective VIN	Production Date
CLA20	JTEYG20V700024166	June, 2004
CLA21	JTEHG20V100066588	
	JTEHG20V906060437	

Field Fix Procedure :

Replace with the modified "V-ribbed Belt".

Part No. Information :

Part Name	Prev. Part No.	New Part No.
V-Belt No.1 (Cooler Compressor to Crankshaft Pulley)	99365-21190	99365-D1190

