



**Technical Service
BULLETIN**

February 17, 2006

Title:

PARKING BRAKE CLICK NOISE

Models:

'06 RAV4

TSB

**BRAKES
BR003-06**

Introduction Some customers may experience a click noise coming from the left rear brake area when utilizing the parking brake hand lever. Updated parking brake shoe lever service parts are available to improve the noise condition.

- Applicable Vehicles**
- **2006** model year **RAV4** vehicles produced **BEFORE** the Production Change Effective VINs shown below.

Production Change Information

MODEL	PLANT	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN
RAV4	Tahara	2WD	JTMBD3#V#65011830
		AWD	JTMZD3#V#65006549
	Shokki	2WD	JTMBD3#V#66004062
		AWD	JTMZD3#V#66003964

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
46602-42040	Same	Lever, Parking Brake Shoe, LH	1

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
473061	Rear Disc (One Side)	0.6	46602-42040	91	57
Combo D	Parking Brake Shoe (One Side)	0.5			


Applicable Warranty*:

This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



Components

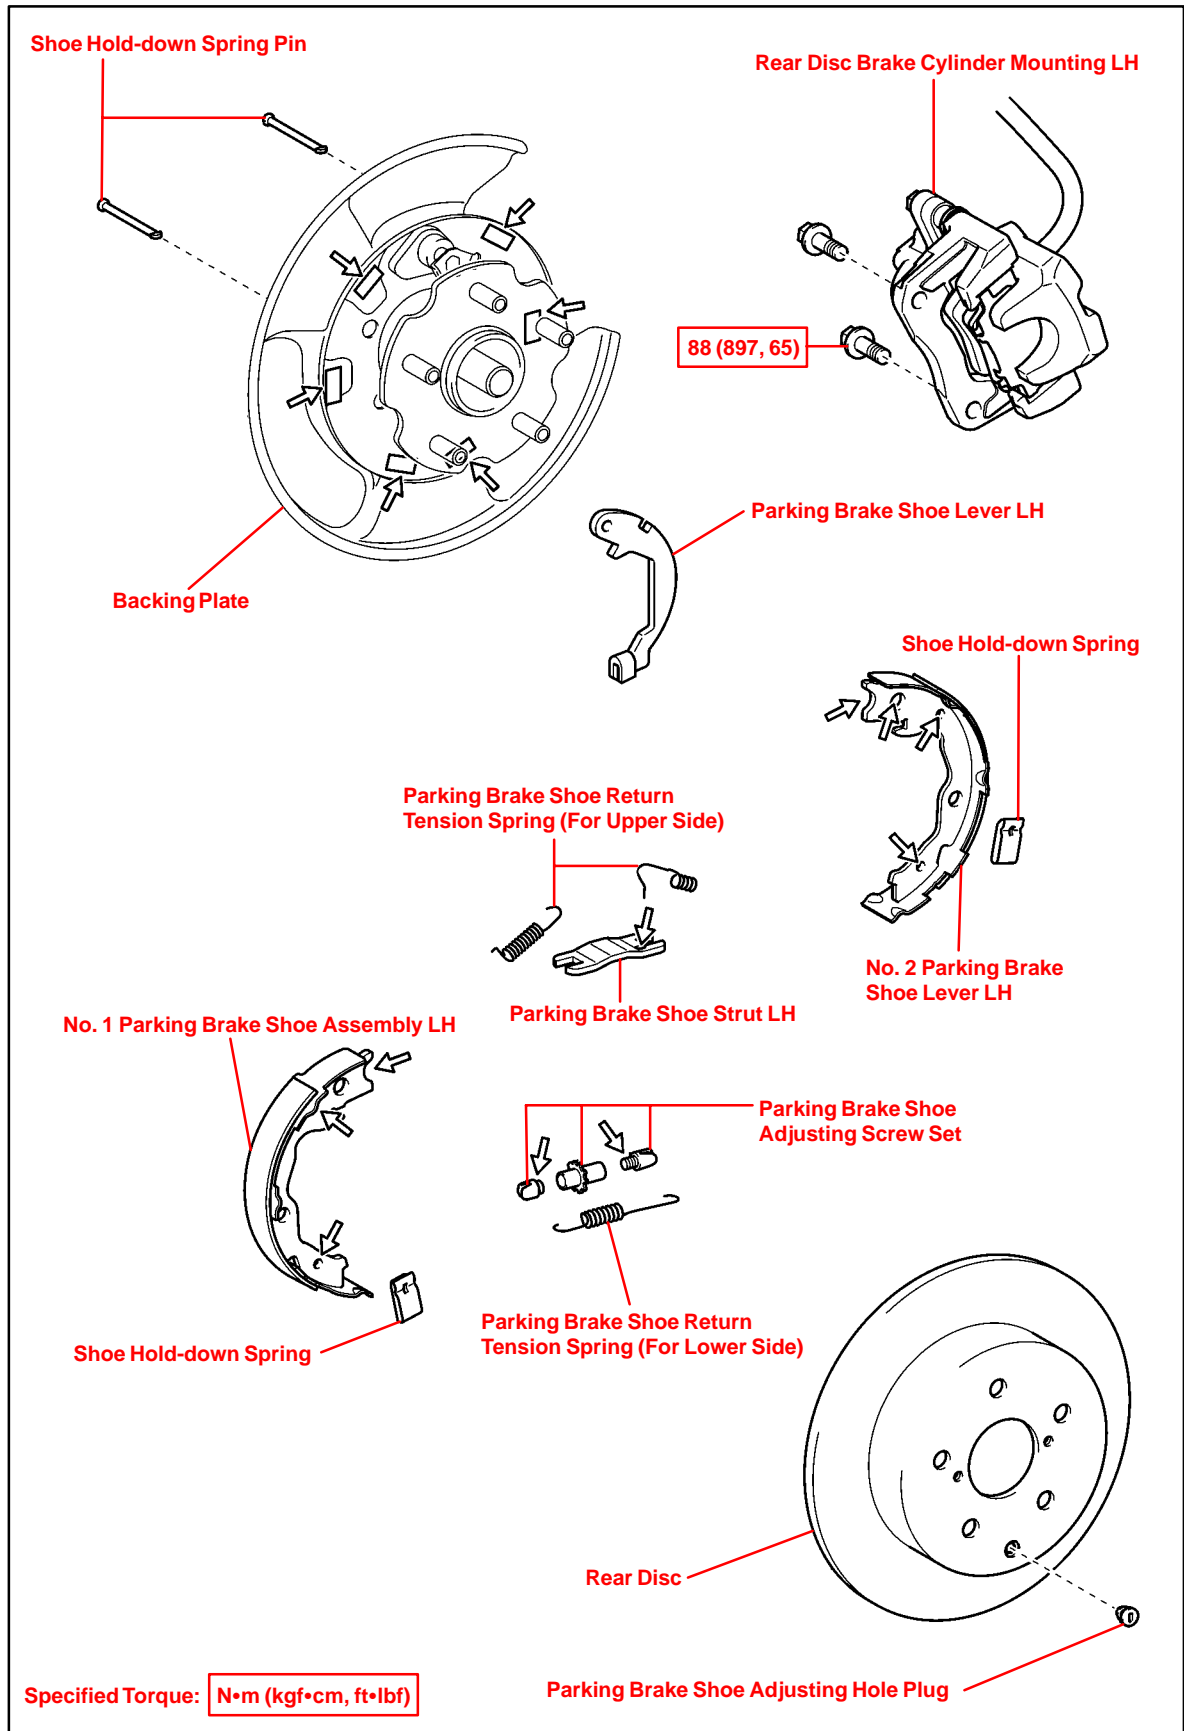

**Repair
Procedure**

1. Operate the parking brake lever several times and listen for a click noise coming from the left rear brake area.
2. Remove and replace the left rear Parking Brake Shoe Lever (P/N: 46602–42040) by following the procedures in the Technical Information System (TIS):

Disassembly:

- 2006 model year RAV4 Repair Manual: *Parking Brake: Parking Brake Assembly: Components, Disassembly, Inspection.*

Reassembly:

- 2006 model year RAV4 Repair Manual: *Parking Brake: Parking Brake Assembly: Reassembly.*

3. Confirm repair by operating the parking brake lever.